

Date: Wednesday, 13/08/2008 10:10:53 AM
 User: Julie Lecocq

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services	Drawing Name : AFT TUBE ASSEMBLY
Job Number : 41194	
Estimate Number : 10699	
P.O. Number :	Part Number : D3391025
This Issue : 13/08/2008 S.O. No. :	Drawing Number : D3391 REV G
Prsht Rev. : NC	Project Number : N/A
First Issue : / / Type : SKIDTUBES	Drawing Revision : G
Previous Run : 41193	Material :
Written By :	Due Date : 28/08/2008 Qty: 1 Um: Each
Checked & Approved By : <u>TUD 08.8.13</u>	
Comment : Est Rev B 06-02-07 ECN773 dwg rev. D EC Est Rev:C 06-03-28 Update Manuf. Instructions JLM est rev D 07.03.20 revF dwg EC est rev E 07.11.07 rev G dwg ecn 1053p EC verified by: DD Est Rev:F 07-11-13 ECN 1056 DD verified by: EC	

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0	D6014090	ALUMINUM EXTRUSION
-----	----------	--------------------



Comment: Qty.: 1.0000 f(s)/Unit Total : 1.0000 f(s)

ALUMINUM EXTRUSION

Pick:

Qty	Part Number	Description	Batch
-----	-------------	-------------	-------

1	D6014-090	Extrusion	<u>B32309</u>
---	-----------	-----------	---------------

Identify as D3391-3

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------

**Comment:** MORI SEIKI CNC LATHE LARGE

Turn as per Folio FA599

Rev: GA & Dwg D3391 Rev: GA

3.0	QC2	INSPECT PARTS AS THEY COME OFF MACHINE
-----	-----	--

**Comment:** INSPECT PARTS AS THEY COME OFF MACHINE

4.0	HAAS1	HAAS CNC VERTICAL MACHINING #1
-----	-------	--------------------------------

**Comment:** HAAS1-Machine as per Folio FA 599 Rev: HA & Dwg D3391 Rev: G

2-Deburr

28 08/09/02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:53 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41194

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

QC2

INSPECT PARTS AS THEY COME OFF MACHINE



Comment: INSPECT PARTS AS THEY COME OFF MACHINE

28 08/09/05

6.0

QC8

SECOND CHECK



Comment: SECOND CHECK

26 08/09/05

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill (PILOT HOLE) aft cap holes per Dwg D3391 using DT8803

27 08-09-04

8.0

BENDING

BENDING MACHINE - SKIDTUBES



Comment: NC Bender

Form as per Dwg D3391 Using Bend Prog 3391025

27 08-09-04

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

28 08/09/04

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Aft cap pilot hole to .208" as per Dwg D3391

2-Drill float bag holes using DT8809 as per Dwg D3391(Holes marked "A" Only.

3-Drill wearplate holes as per Dwg D3391 using DT8878(Mid Tube) & DT8217 Wearplate Jig .

*****Do Not Open To Finished Size*****

4-Drill Wearshoe holes as per DWG D3391 using DT8939 locating from 2 previously drilled aft wearplate holes.

5-Open wearplate holes to 0.250" and c'bore as per dwg D3391

6-Open up all wearshoe , wearplate to 0.297"and float bag holes to 0.328" as per Dwg D3391.

7-Deburr

M
3-9-8
3-9-9

Tools: rill

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:53 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41194

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/08/08 (41)

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid etch and Alodine as per QSI 005 4.1

AWM 8-9-9

13.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

D H 8-9-9

14.0

D36704200

SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

SPACER

batch: D 36818

D H 8-9-9

15.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Instal spacers as per dwg D3391

A/R Magnabond 6398 Batch: M108966

exp. date: 12/08/08 9-10-1

cure time 12hrs as per QSI0015

H 8-9-9

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/08/08 (41)

17.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M108523

START TIME:

2:00 pm

OVEN TEMPERATURE:

320°F

FINISH TIME:

2:30 pm

9/08-08-11

(41)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:53 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41194

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 08/09/12 ①

19.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Aft Cap

Pick:

Qty Part Number Description Batch

1 D2646 Aft Cap

B37377

FL

20.0

D35371

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

WEARPAD

B38941

FL

21.0

D35377

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Wearpad

B33869

FL

22.0

D35531

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Gasket

B32740

FL

23.0

D35533

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Gasket

B33870

FL

24.0

D36721

Phenolic Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

PHENOLIC WASHER

B39275

FL

25.0

ALS41032130

Insert



Comment: Qty.: 14.0000 Each(s)/Unit Total: 14.0000 Each(s)

INSERT

batch: M105815

FL 08/09/12 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ^A No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:53 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41194

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

or equivalent per
QSI 017

26.0

ALS41032225

Insert



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

INSERT

or equivalent

Per QSI 017

m100489

FL

27.0

AN3C4A

BOLT



Comment: Qty.: 6.0000 Each(s)/Unit Total : 6.0000 Each(s)

Bolt

Pick:

Qty

Part Number

Description

Batch

2

AN3C4A

Bolt

m109148

FL

28.0

AN3C5A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

m108744

FL

29.0

AN960C10L

washer



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Inventory

Pick:

Qty

Part Number

Description

Batch

2

AN960C10L

Washer

m109147

FL

30.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: SMALL & MEDIUM FAB RESOURCE 1

1-Install inserts as per Dwg D3391

2-Install Aft Cap as per Dwg D3391

A/R Sikaflex-241/-291

Sikaflex expiry date:

m108801
08/10

FL 08/09/12 (P)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 13/08/2008 10:10:53 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT TUBE ASSEMBLY

Job Number: 41194

Part Number: D3391025

Job Number:



Seq. #:

Machine Or Operation:

Description :

31.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/08/16

32.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock

Location: _____

PPR 40501A

33.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08/09/16

Job Completion



MF 08-09-16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order: 41194
Description: Float Skidtube (412)		Part Number: D3391-3
Inspection Dwg: D3391	Rev: G	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

checked by
S 6/6/03

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
14.000	+/-0.010	14.000	✓			
3.500	+/-0.010	3.495	✓			
88.93	+/-0.030	88.925	✓			
44.995	+/-0.030	44.995				
3.200	+/-0.010	3.203	✓			
1.526	+0.000/-0.030	1.514	✓			
0.200	+/-0.010	.200	✓			
7.500	+/-0.010	7.500	✓			
27.750	+/-0.010	27.750	✓			
31.750	+/-0.010	31.750	✓			
35.250	+/-0.010	35.250	✓			
3.300	+/-0.010	3.306	✓			
0.200	+/-0.010					
3.520	+/-0.010	3.517	✓			
0.687	+0.010/-0.000	.687	✓			
R0.062	+/-0.010	.062	✓			
Ø0.484	+0.005/-0.001	.488	✓			

Measured by: a.m./sp	Audited by: 140	Prototype Approval:	N/A
Date: 08.04.20	Date: 08/09/03	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	06.04.24	New Issue P/O D3391-015/-025	KJ/JLM	
B	06.06.19	Dwg revision update	KJ/JLM	
C	07.04.20	Ø0.208 dimension removed	KJ/JLM	
D	07.09.06	0.400 dimension removed	KJ/JLM	
E	07.11.23	Dwg Rev. updated	KJ/EC/DD	

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

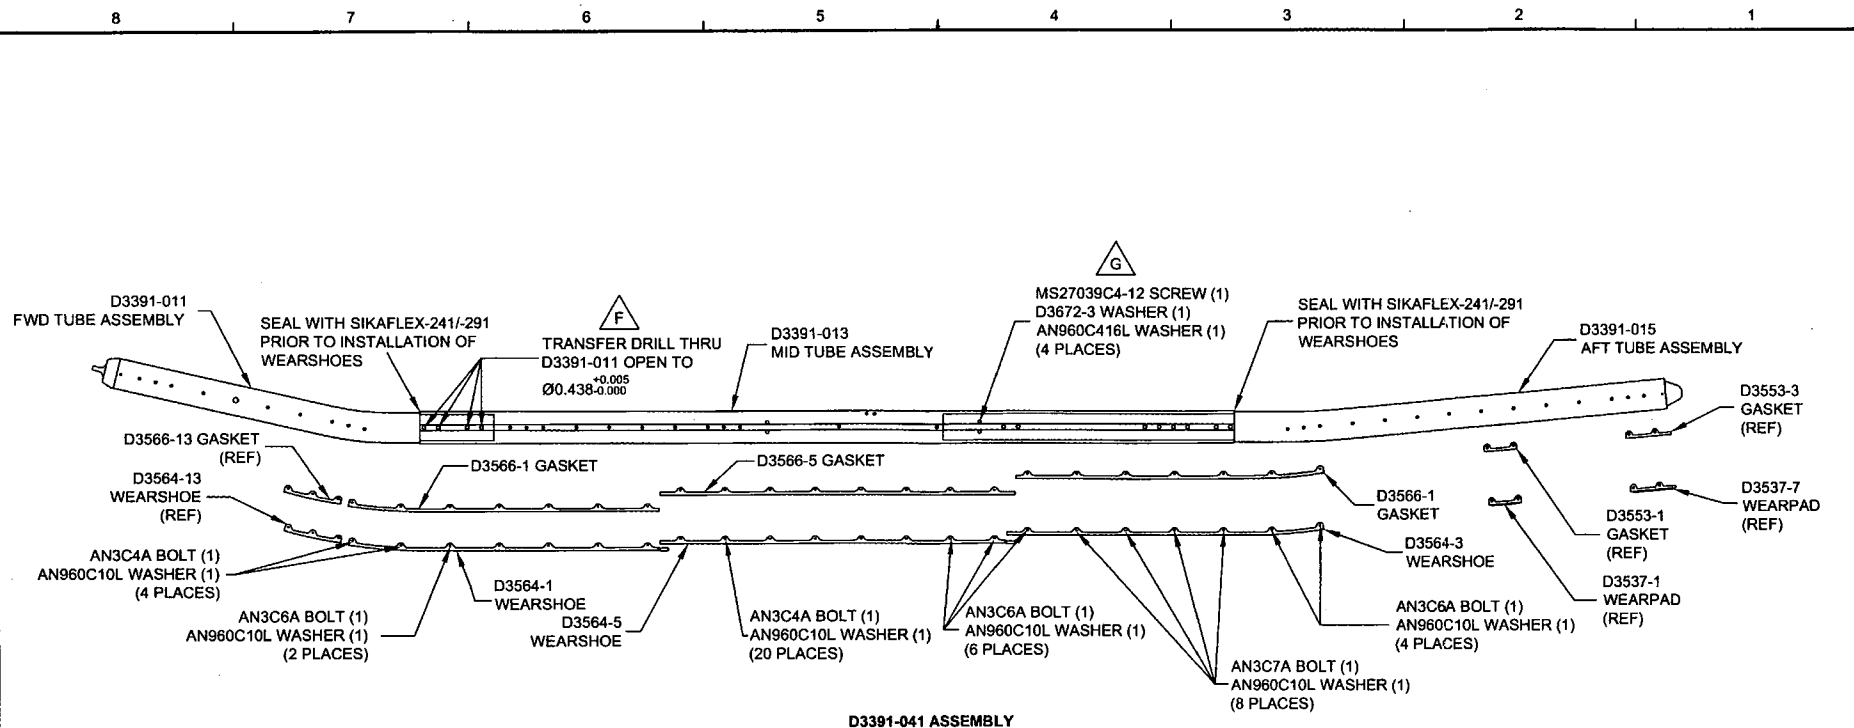

RELEASED
07.11.06

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
1	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
4	D3672-3	WASHER
24	AN3C4A	BOLT
12	AN3C6A	BOLT
8	AN3C7A	BOLT
44	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH
AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH
LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS
OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.

G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	07.07.31		


DART AEROSPACE USA, INC
PORT HADLOCK, WA

DRAWING NO. D3391
REV. G
SHEET 1 OF 8

TITLE 412 FLOAT SKIDTUBE
SCALE NTS

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC

WITHOUT NOTICE
WORK ORDER
NO. 41194
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

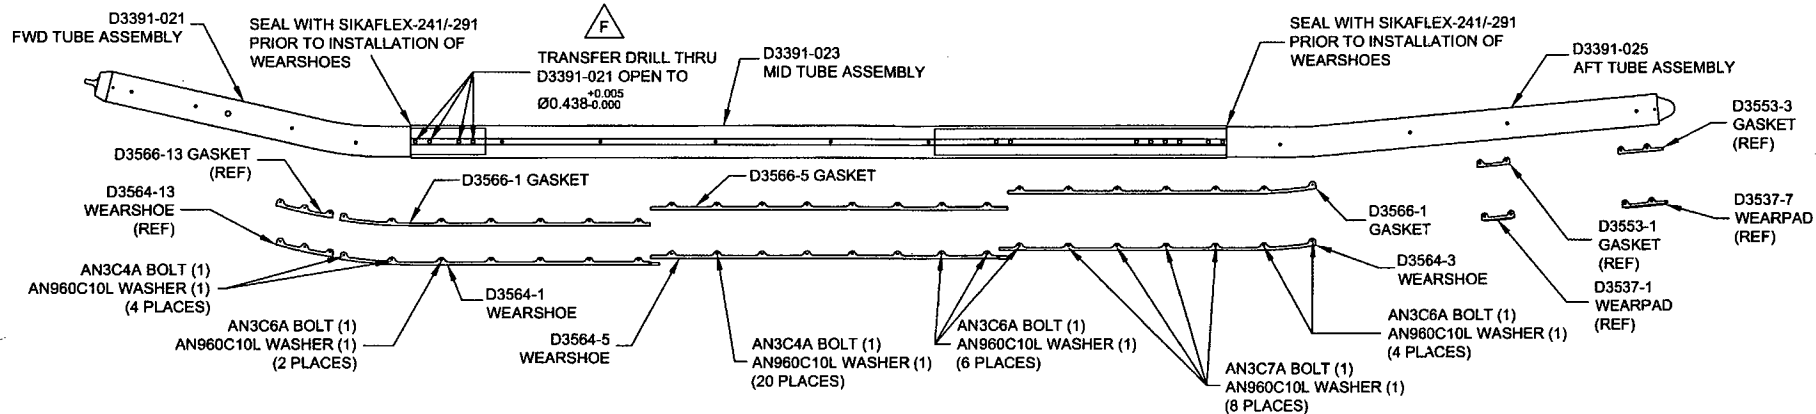

D3391-043 ASSEMBLY

RELEASED
07.11.91

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST


QTY	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
1	D3564-1	WEARSHOE
1	D3564-3	WEARSHOE
1	D3564-5	WEARSHOE
2	D3566-1	GASKET
1	D3566-5	GASKET
24	AN3C4A	BOLT
12	AN3C6A	BOLT
6	AN3C7A	BOLT
1	AN960C10L	WASHER

GENERAL NOTES


- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY. CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.

DESIGN	IN	DART AEROSPACE USA, INC	
DRAWN	JTC	PORT HADLOCK, WA	
CHECKED	JTC	DRAWING NO. D3391	REV. G
MFG. APPR.	JTC	SHEET 2 OF 8	
APPROVED	JTC	SCALE	
DE APPR.	JTC	412 FLOAT SKIDTUBE NTS	
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	


NO WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
RETURN TO
ENGINEERING
SHOP COPY

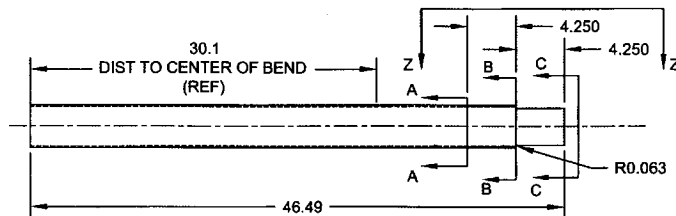


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

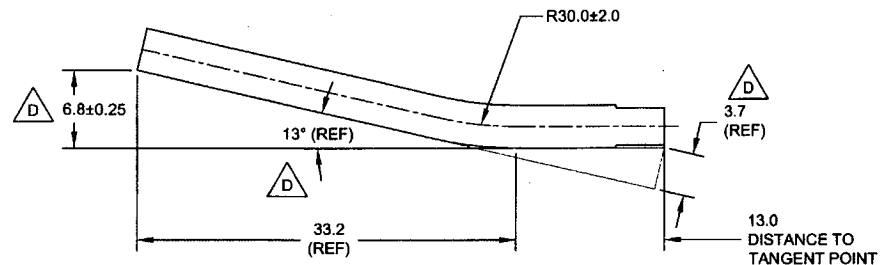


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

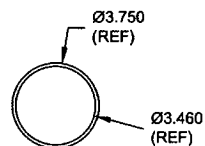


SECTION A-A
(SCALE 1:5)

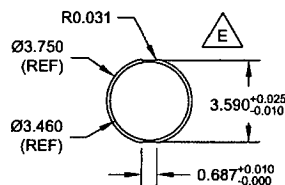

SECTION B-B
(SCALE 1:5)

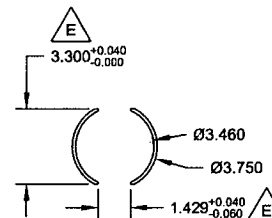

SECTION C-C
(SCALE 1:5)

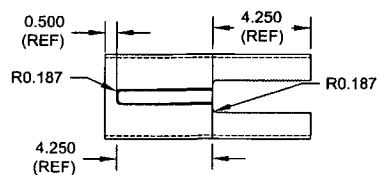


VIEW Z-Z
(SCALE 1:5)


RELEASED
07.11.08

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 51194


DESIGN		DART AEROSPACE USA, INC	
DRAWN	<i>[Signature]</i>	PORT HADLOCK, WA	
CHECKED	<i>[Signature]</i>	DRAWING NO. D3391	REV. G
MFG. APPR.	<i>[Signature]</i>	SHEET 3 OF 8	
APPROVED	<i>[Signature]</i>	TITLE 412 FLOAT SKIDTUBE	
DE APPR.	<i>[Signature]</i>	SCALE 1:10	
DATE	07.07.31	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC</small>	

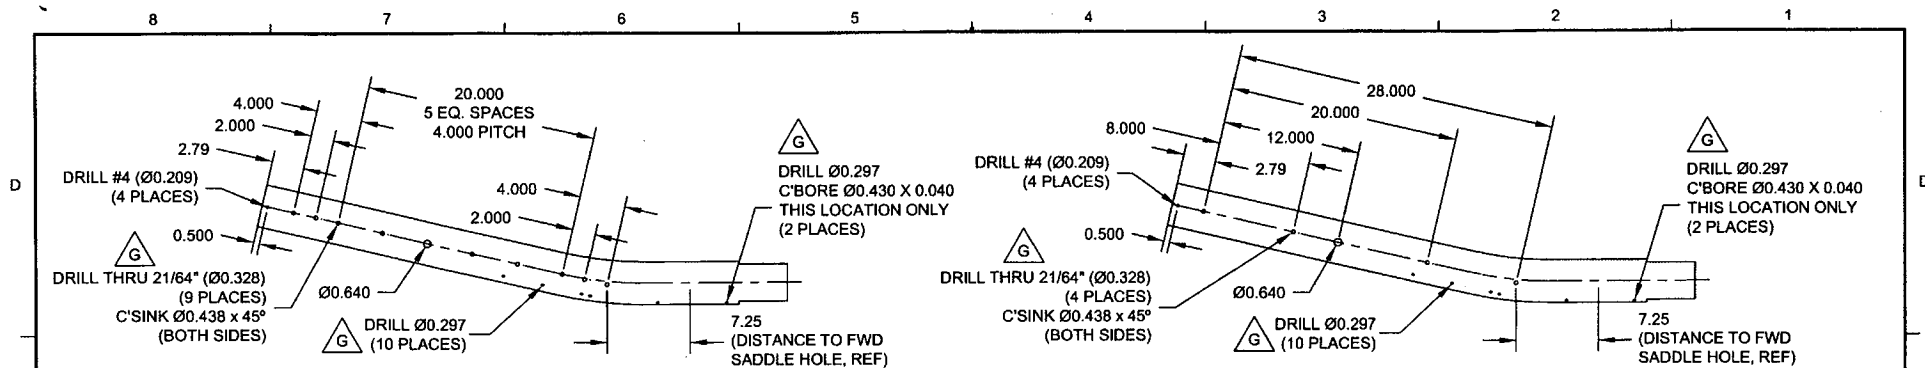


D3391-011 DRILLING DETAIL

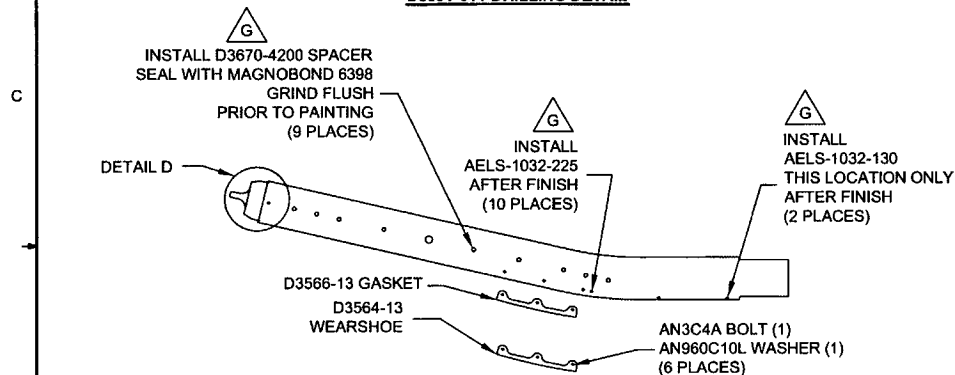

D3391-011 ASSEMBLY DETAIL

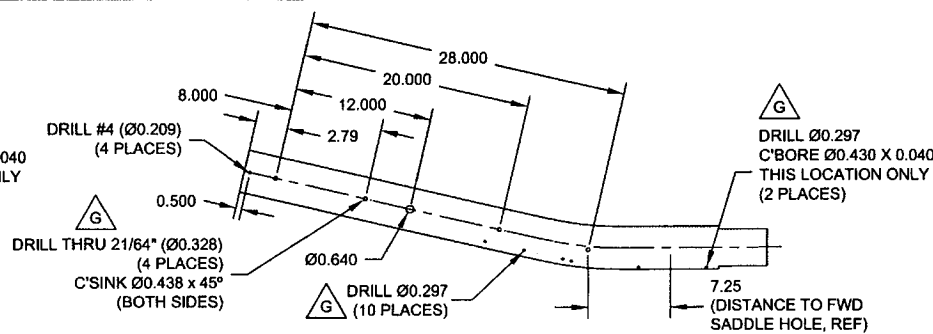

D3391-021 DRILLING DETAIL

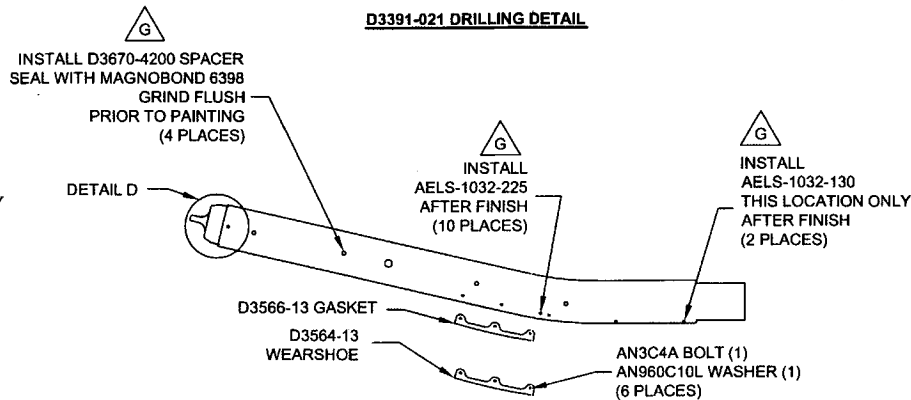


D3391-021 ASSEMBLY DETAIL

RELEASED
07-11-06


D3391-011/-021 FWD TUBE ASSEMBLY PARTS LIST

QTY - 011	QTY - 021	PART NUMBER	DESCRIPTION
X		D3391-011	FWD TUBE ASSEMBLY
	X	D3391-021	FWD TUBE ASSEMBLY
1	1	D6013-047	FWD TUBE
1	1	D3401-041	TOW CAP
1	1	D3564-13	WEARSHOE
1	1	D3566-13	GASKET
4	4	D3670-4200	SPACER
4	4	D3672-1	WASHER
1	1	AN3C4A	BOLT
1	1	AN960C10L	WASHER
1	1	AELS-1032-130	INSERT
1	1	AELS-1032-225	INSERT

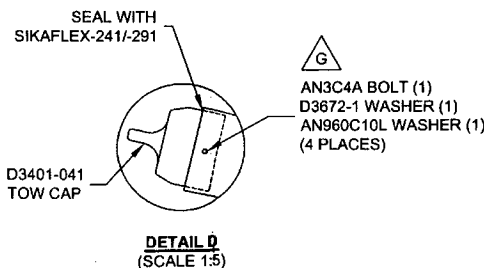


NO WORK ORDER
UNCONTROLLED COPY
STRIKE OFF TO AN END
WITHOUT NOTICE
COPY
RETURN TO
ENGINEERING
SECTION

DESIGN		DART AEROSPACE USA, INC	
DRAWN		PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. G
MFG. APPR.		D3391	SHEET 4 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	1:10
DATE	07.07.31	COPYRIGHT © 2003 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

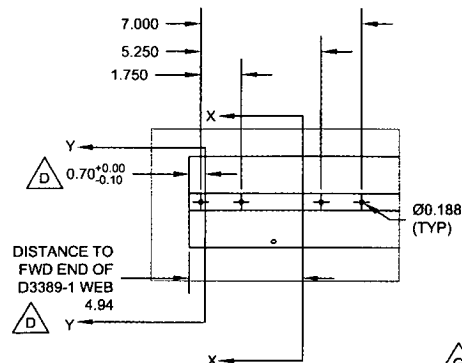


DETAIL J
(SCALE 1:5)


DRILL THRU 21/64" (Ø0.328)
C'SINK Ø0.438 X 45° (BOTH SIDES)
(12 PLACES)

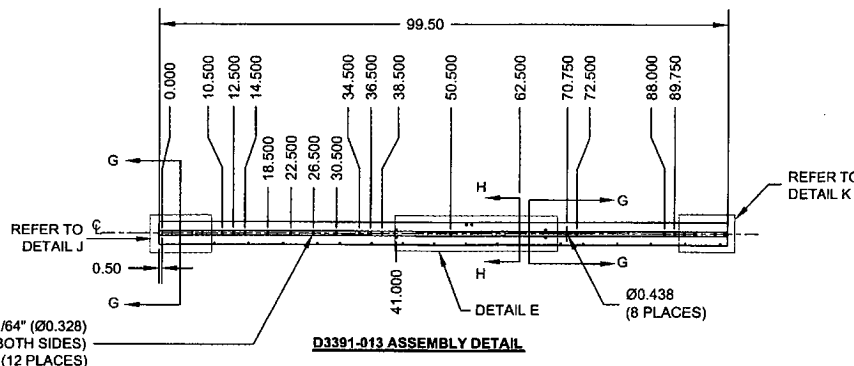


D3391-013 ASSEMBLY DETAIL

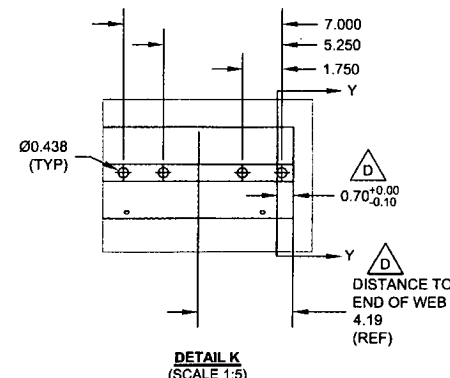


DETAIL K
(SCALE 1:5)

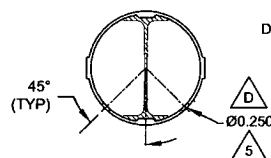


SECTION G-G
(SCALE 1:4)

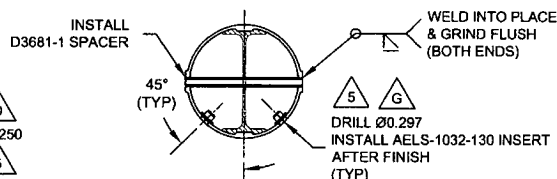

SECTION H-H
(SCALE 1:4)

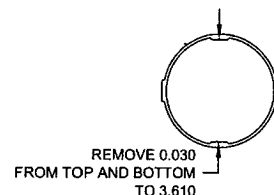


SECTION X-X
(SCALE 1:4)

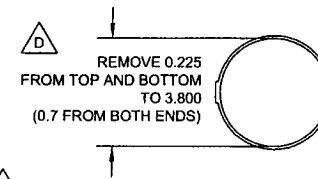


SECTION Y-Y
(SCALE 1:4)

DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
(TYP 4 PLACES)

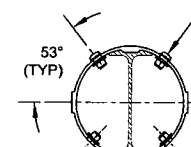


SECTION M-M
(SCALE 1:4)

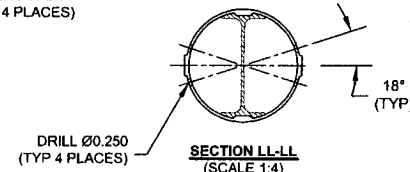


SECTION L-L
(SCALE 1:4)

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY -013	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
12	D3681-1	SPACER
4	D3672-1	WASHER
4	D3672-3	WASHER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

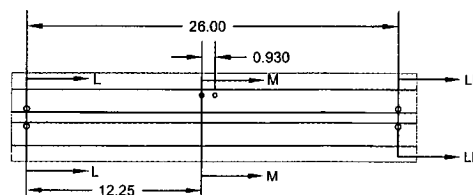

DETAIL E
(SCALE 1:8)

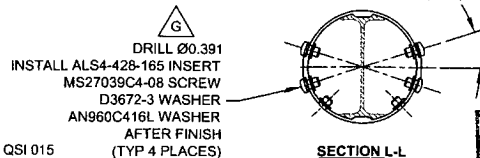






SECTION L-L
(SCALE 1:4)

RELEASED
07-11-2017

DESIGN	AM	DART AEROSPACE USA, INC	
DRAWN	DE	PORT HADLOCK, WA	
CHECKED	DE	DRAWING NO.	REV. G
MFG. APPR.	DE	D3391	SHEET 5 OF 8
APPROVED	DE	TITLE	SCALE
DE APPR.	DE	412 FLOAT SKIDTUBE	1:20
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO. 211974
WORK ORDER
WITHOUT NOTICE
RETURN TO
ENGINEERING
CONTROLLED COPY
FOR ORDER

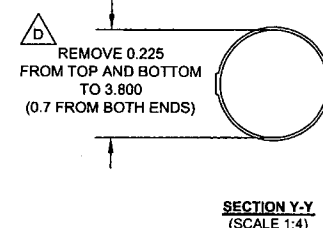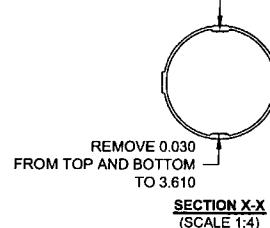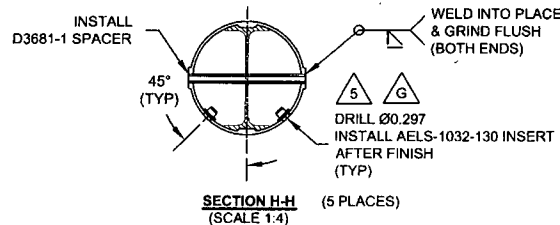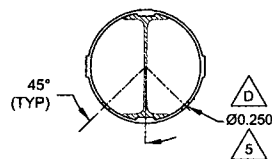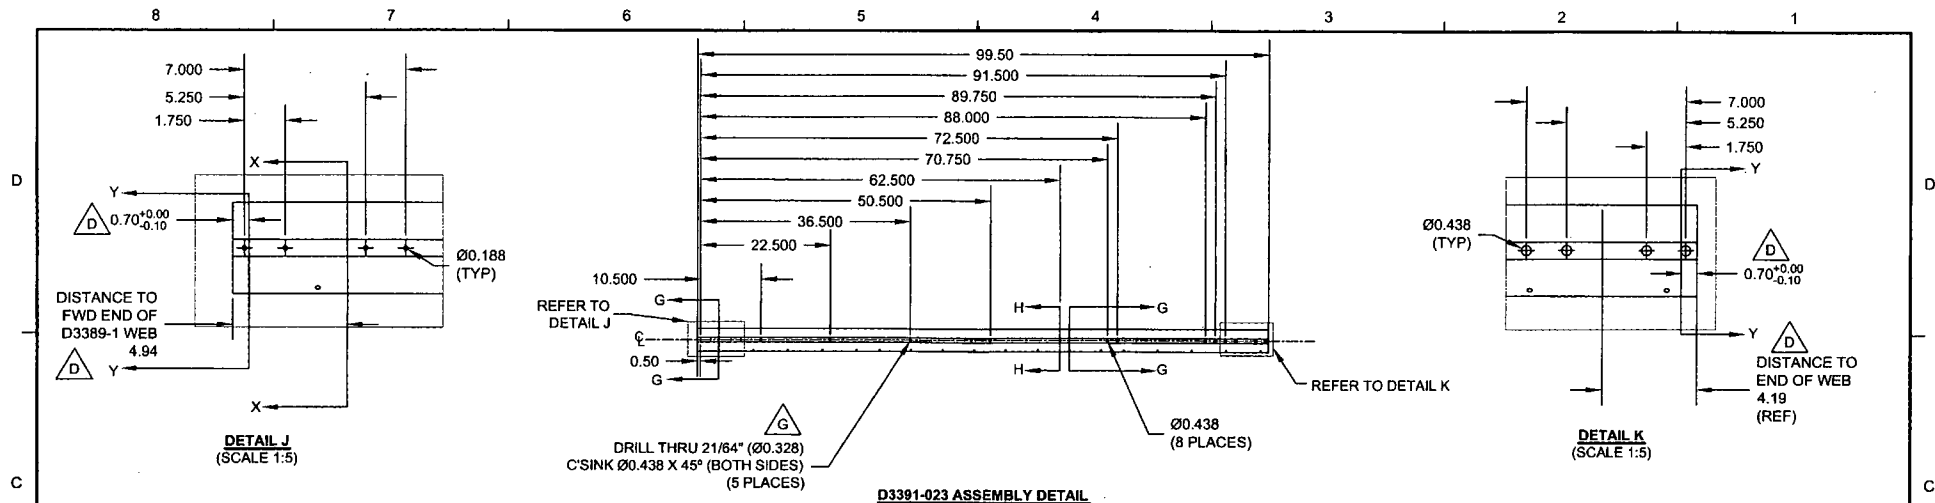

D3391-023 MID TUBE ASSEMBLY PARTS LIST


QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

RELEASED
07.11.06/11



DESIGN	PH	DART AEROSPACE USA, INC
DRAWN	DL	PORT HADLOCK, WA
CHECKED	DL	DRAWING NO. D3391
MFG. APPR.	DL	REV. G SHEET 6 OF 8
APPROVED	DL	TITLE 412 FLOAT SKIDTUBE
DE APPR.	DL	SCALE 1:20
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC

D3391-023 MID TUBE ASSEMBLY
MATERIAL TAKE FROM D2500-1-100 EXTRUSION
INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-2411/291 PER QSI 015
WELDING PER QSI 004

NO WORK ORDER
WITHOUT NOTICE
TO AMENDMENT
CONTROLLED COPY
RETURN TO
ENGINEERING
FOR COPY
TOP COPY

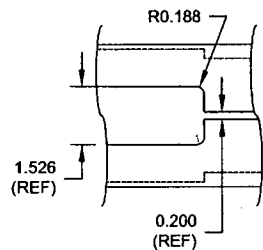


VIEW BB-BB
(SCALE 1:3)

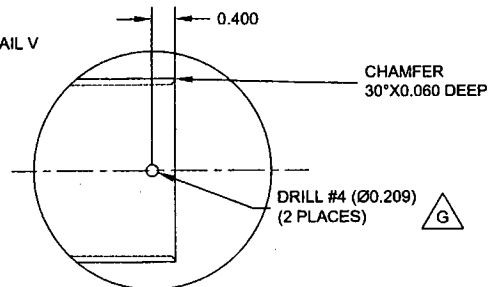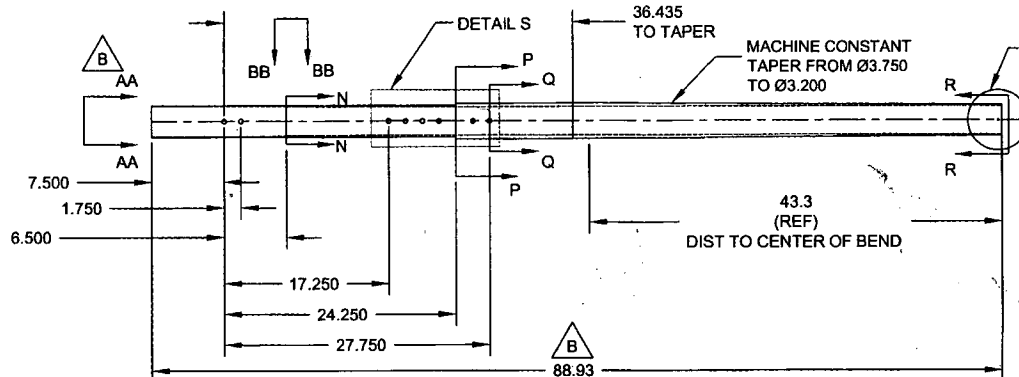


DETAIL V
(SCALE 1:2)


D3391-3 AFT DRILLING AND CUTTING DETAIL
(MAKE FROM D6014-090 SKIDTUBE MATERIAL)

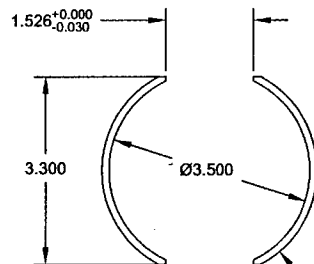


SECTION AA-AA
(SCALE 1:2)

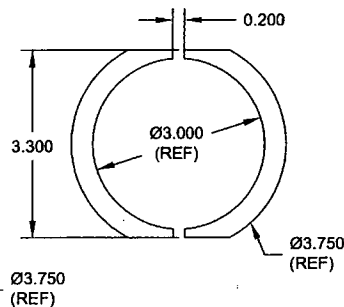


SECTION N-N
(SCALE 1:2)

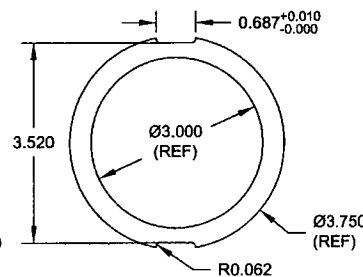


SECTION P-P
(SCALE 1:2)

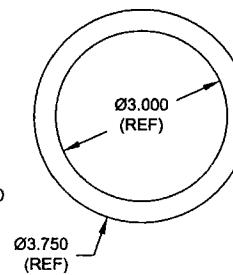


SECTION Q-Q
(SCALE 1:2)

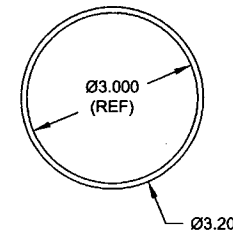

SECTION R-R
(SCALE 1:2)

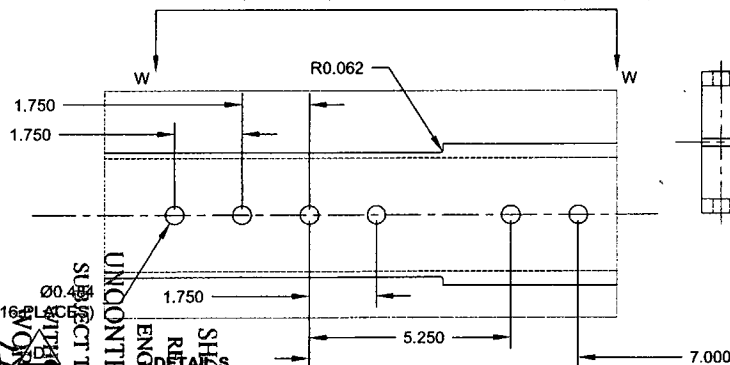

VIEW W-W
(SCALE 1:3)

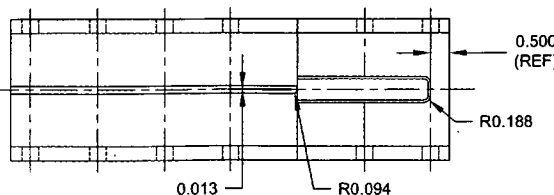


RELEASED
07-11-06

DESIGN		DART AEROSPACE USA, INC
DRAWN		PORT HADLOCK, WA
CHECKED		DRAWING NO. D3391
MFG. APPR.		REV. G SHEET 7 OF 8
APPROVED		TITLE 412 FLOAT SKIDTUBE
DE APPR.		SCALE 1:12
DATE	07.07.31	

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO
11/19/97
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
11/19/97
COPY
SHOULD
BE
MADE
TO
DETAILS
SCALE 1:3
ENGINEERING

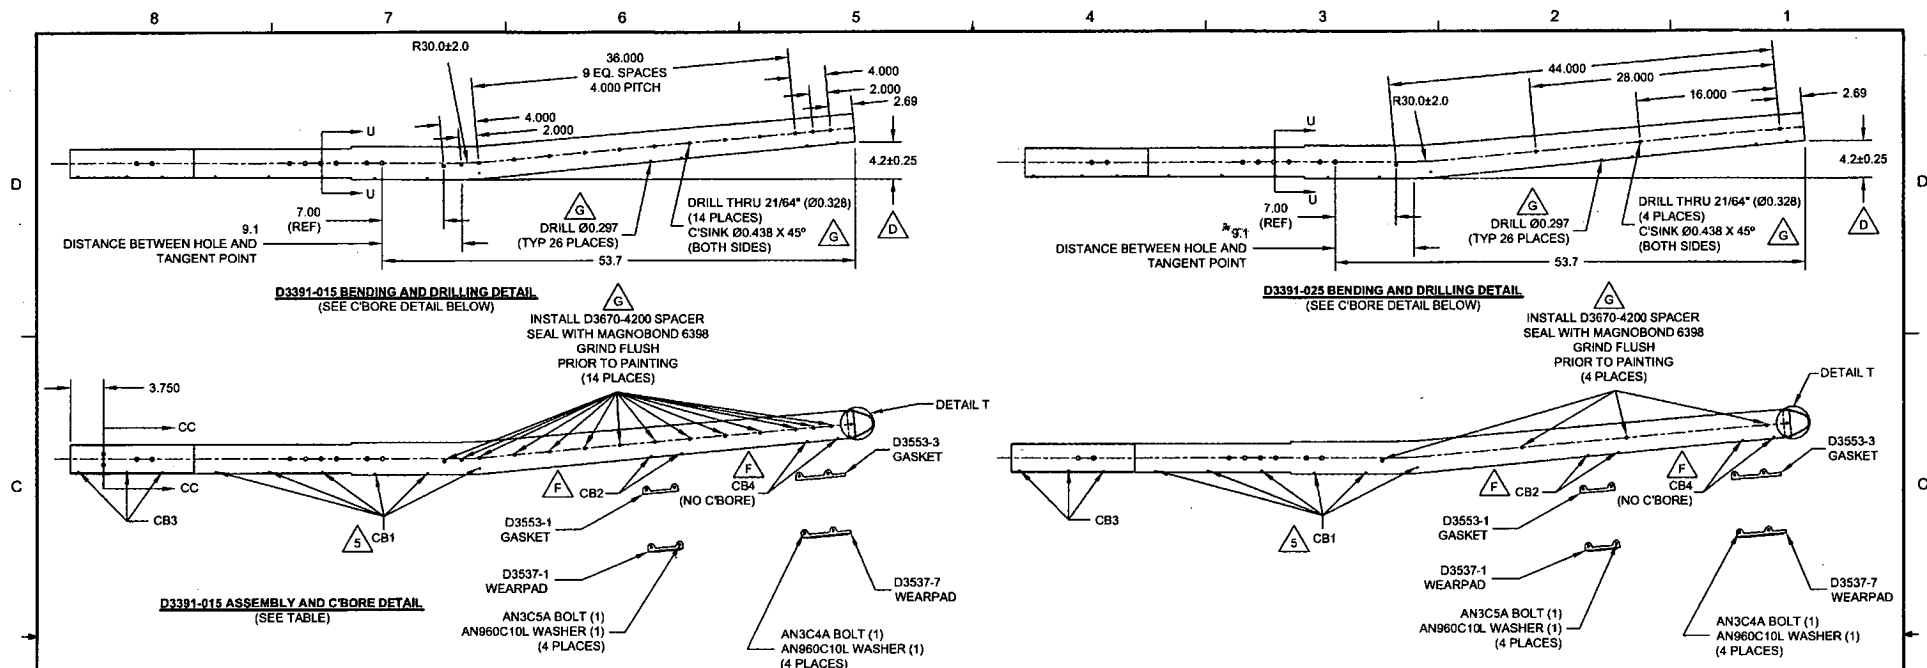

D3391-015/025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D6014-090	AFT TUBE
1	1	D2646	AFT CAP
1	1	D3537-1	WEARPAD
1	1	D3537-7	WEARPAD
1	1	D3553-1	GASKET
1	1	D3553-3	GASKET
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
14	14	AELS-1032-130	INSERT
12	12	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

C'BORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	C'BORE	P/N
CB1	12	12	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

RELEASED
07.11.06

DESIGN	HH	DART AEROSPACE USA, INC	
DRAWN	DC	PORT HADLOCK, WA	
CHECKED	JS	DRAWING NO.	REV. G
MFG. APPR.	JS	D3391	SHEET 8 OF 8
APPROVED	JS	TITLE	SCALE
DE APPR.	JS	412 FLOAT SKIDTUBE	1:12
DATE	07.07.31	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC	

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

NO
WORK ORDER
411947
RETURN TO
ENGINEERING
SITOP COPY
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

